

COEMAR TECHNICAL TIPS

FIXTURE:	Infinity Wash XL	DATE:	18/07/2007
TITLE:	Fans Airflow in Infinity Wash XL	FROM:	info.design@coemar.com
REF:	Coemar internal communication no. 02/2007		

6 – Fans Airflow in Infinity Wash XL

ISSUE	<p>The lamp could turn off due to the command of the electronic ballast's thermal switch, in the fixtures with the following serial no.:</p> <ul style="list-style-type: none"> - from CO9135 1368 06001 to CO9135 1368 06050 - from CO9135 1370 06001 to CO9135 1370 06100 - from CO9135 0021 07001 to CO9135 0021 07030 - from CO9135 0318 07001 to CO9135 0318 07020
REASONS	<p>The ambient in which these fixtures normally operate reaches temperatures close to 35°C for over 25-30 minutes.</p>
SOLUTION	<p>To avoid the overheating of the ballast, the fans model used and their airflow positioning must be checked. Contact Coemar for detailed instructions.</p>
AVAILABILITY	<p>Starting from <i>S.N. CO9135 0163 07001</i> (April 2007) the issue has been addressed.</p>

For more information, please contact info.design@coemar.com or service@coemar.com

COEMAR TECHNICAL TIPS

FIXTURE:	Infinity Wash XL	DATE:	18/07/2007
TITLE:	Thermal switch for Infinity Wash XL	FROM:	info.design@coemar.com
REF:	Coemar internal communication no. 02/2007		

7 – Thermal Switch for Infinity Wash XL

ISSUE	The possibility of increased safety features was noticed.
REASONS	A thermal switch could have been installed in the head of the product.
SOLUTION	To install the thermal switch, you need KIT 147.
AVAILABILITY	KIT 147 is available upon request from April 2007. Starting from <i>S.N. CO9135016307001</i> the thermal switch is standard on all fixtures.

For more information, please contact info.design@coemar.com or service@coemar.com

COEMAR TECHNICAL TIPS

FIXTURE:	Infinity Wash XL	DATE:	18/07/2007
TITLE:	Weight correction for Infinity Wash XL	FROM:	info.design@coemar.com
REF:	Technical Office		

5 – Weight Correction for Infinity Wash XL

ISSUE	The actual weight of the fixture is higher than previously declared on general catalogue, website, and instruction manual.
REASONS	A normal human mistake is at the source of the wrong communication.
SOLUTION	The actual weight of the fixture is 45 Kg and not 36 Kg like previously indicated.
AVAILABILITY	New datasheets of the projector indicate the correct measurements.

For more information, please contact info.design@coemar.com or service@coemar.com